


NOTES

FOR PRESTRESSED GIRDER REPAIR DETAILS, SEE "PRESTRESSED GIRDER REPAIR DETAILS AND SUMMARY" SHEET.

THE LOCATIONS AND DIMENSIONS OF THE AREAS FOR REPAIR ARE BASED ON THE BEST INFORMATION AVAILABLE. THE CONTRACTOR, IN CONJUNCTION WITH THE ENGINEER, SHALL VERIFY THE LOCATION AND EXTENT OF REPAIR AREAS PRIOR TO GIRDER REPAIR.

① GIRDER NUMBER


GIRDER REPAIR LOCATIONS			
GIRDER	LOCATION	REPAIR SIZE (L x W)	LABEL
1	BT. FL.	6" x 6"	A
2	WEB & BT. FL.	8" x 11"	B
4	L.S. OF BT. FL.	10" x 1'-0"	C
5	WEB & BT. FL.	1'-2" x 1'-9"	D

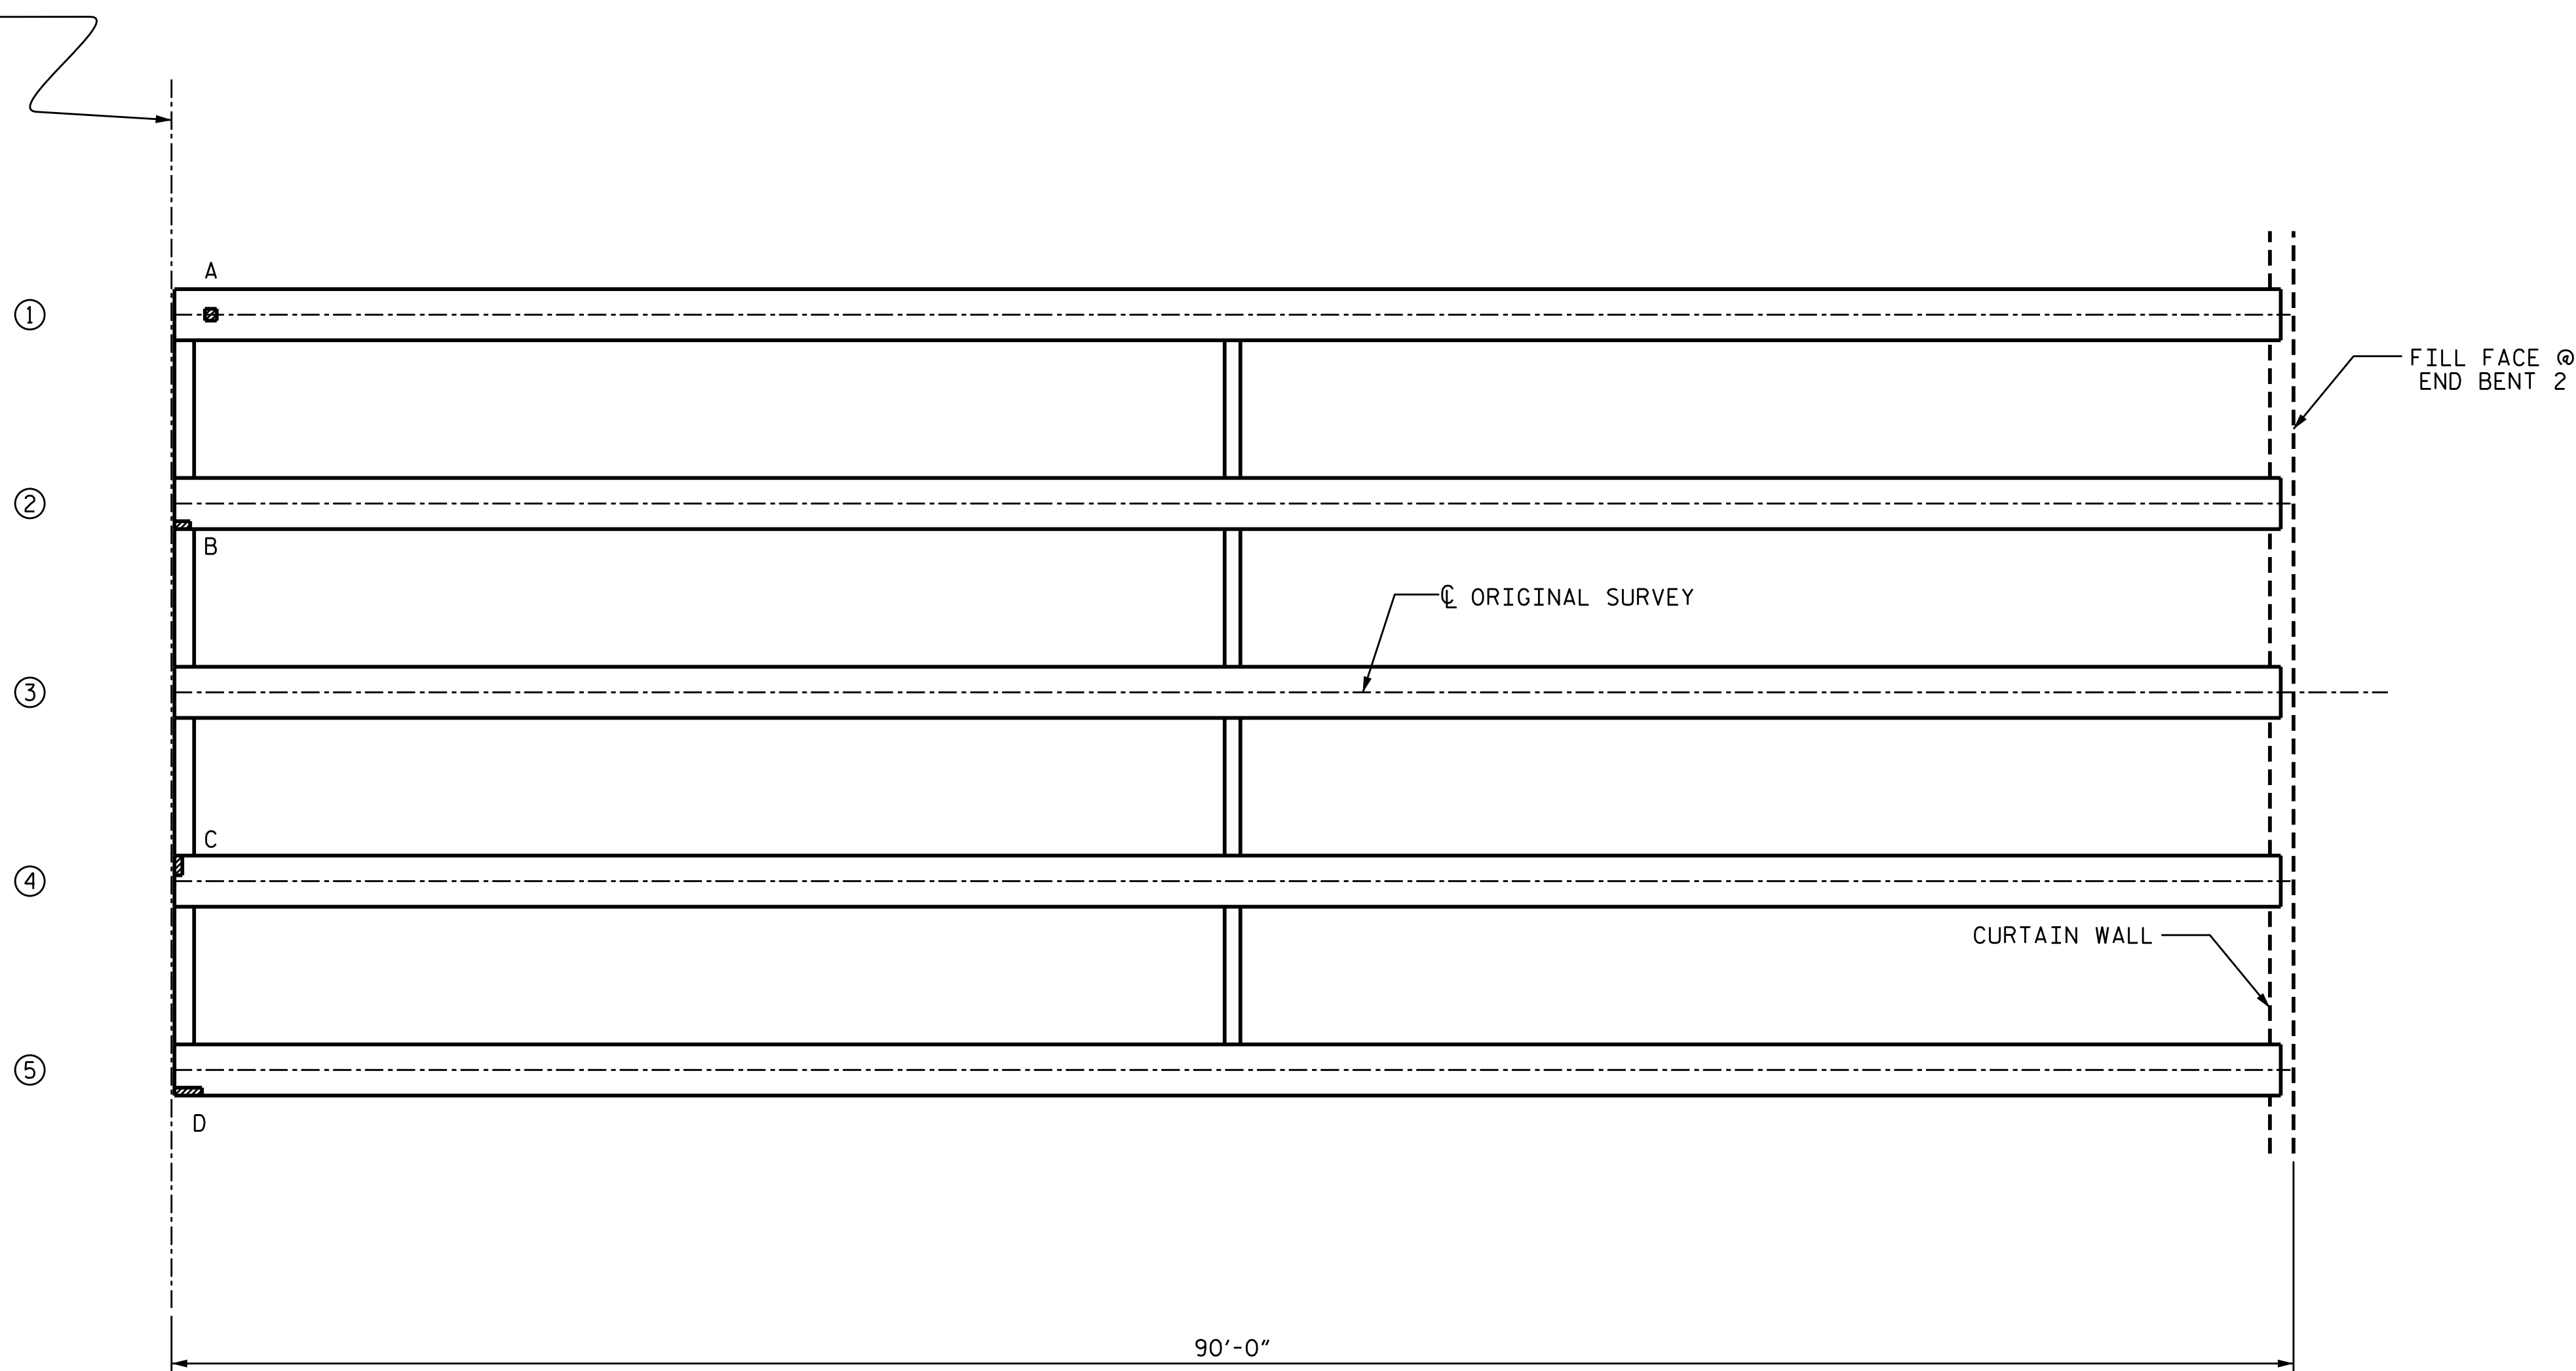

PRESTRESSED GIRDER REPAIR LOCATIONS
(OTHER LOCATIONS MAY EXIST, SEE NOTES)

PROJECT NO. 15BPR.18
DAVIE COUNTY
BRIDGE NO. 63

SHEET 10 OF 10

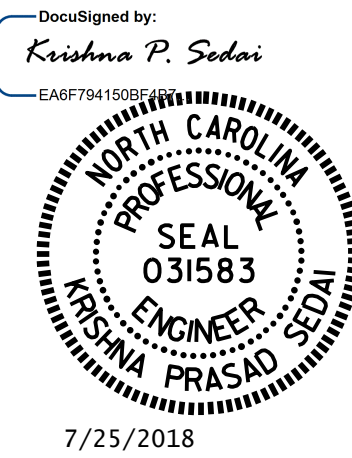

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH

PRESTRESSED GIRDER
REPAIR LOCATIONS

SPAN J

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	S-18
1			3			TOTAL SHEETS
2			4			38

DRAWN BY : H.A. LOCKLEAR DATE : 6-18
CHECKED BY : M.G. SHAIKH DATE : 6-18

DOCUMENT NOT CONSIDERED
FINAL UNLESS ALL
SIGNATURES COMPLETED